SK[®] U760E

Corrects/Prevents/Reduces

For Professional Use Only!



Shuttle shift, flare on 2-3 shift, slips with throttle in 3rd and/or 4th, TCC slip codes.


Fits:

Toyota: U760 6 speed:


Highlander 10-12 2.7L, Scion tc 2012 2.5L Sienna 11-12 2.7L, Venza 10-12 2.7L

Lexus: U760 6 speed:

RX 10-12 2.7L

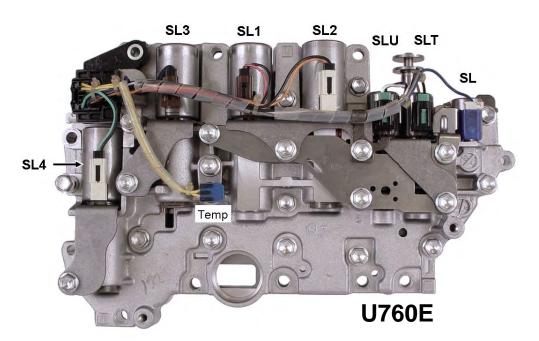

This Product Does Not Fit U660E Models! Order SK®U660E

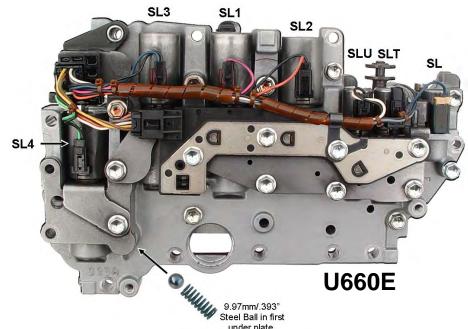


Tech Note:

Always mark the current locations of check balls, retainers etc. to insure they are returned to their original locations even if they differ from what is shown. This is a typical layout of these valve body's. Use care in disassembling.

Planetary failure always REQUIRES a complete strip and cleaning of the valve-body!



Accumulator Body Repairs

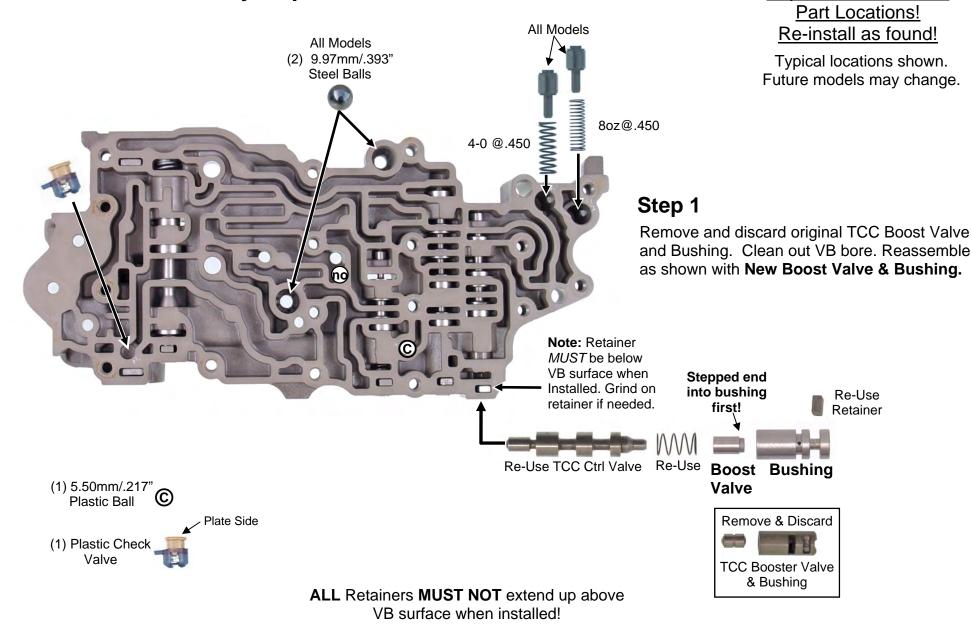

Pay Attention to Small

Mid-Body Repairs


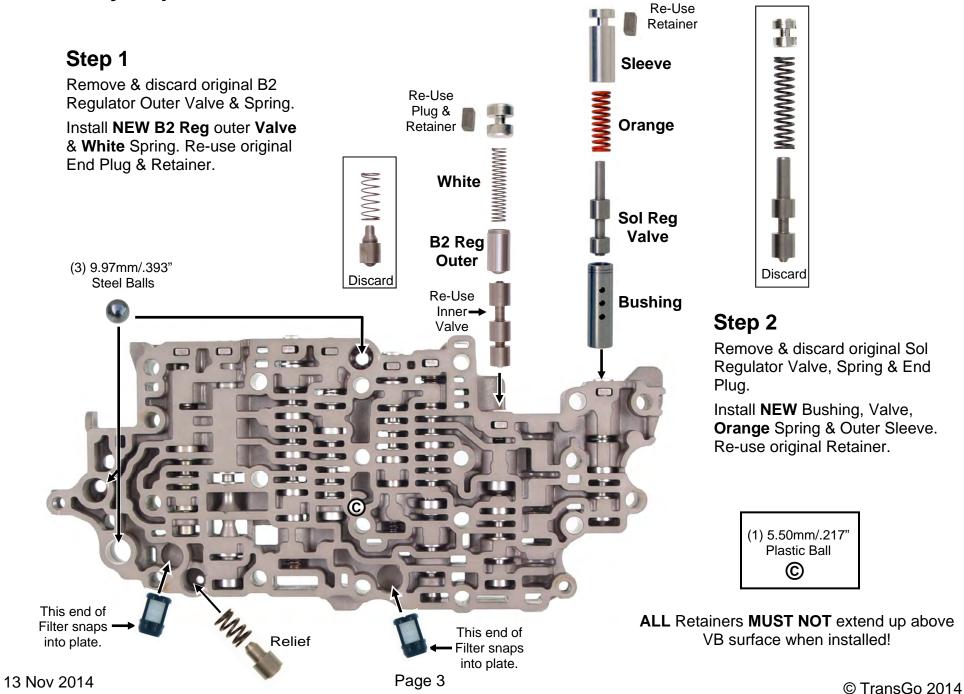


Plate Updates

Help This Trans Stay Cool! Do these steps!

Step 2


Enlarge Lower Body bottom separator plate hole "B" with .055 drill provided.

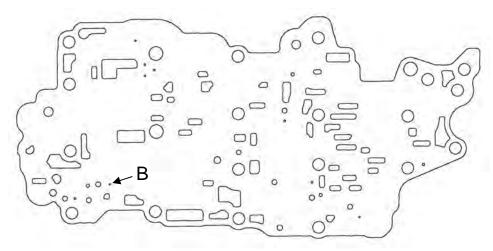

U760E Accumulator Body Separator Plate

Step 1

Enlarge main separator plate hole "A" with .055 drill provided. Ok if already bigger.

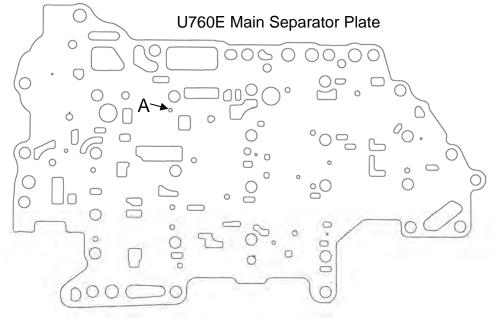

This page ends the U760E repair work. Always reassemble any loose small parts the way you found them.